

RISK MANAGEMENT REPORT

TYPE	Excavator - Small (0 - 9.9 Tonne)	
MAKE	Yanmar	TUTT BRYANT EQUIPMENT
MODEL	VIO17-1	A Member of the Tutt Bryant Group
SERIAL NUMBER	12017	
ENGINE NUMBER	T2538	
Report Number	BTE 20220322-1618	
Date	29-Apr-2022	
Created By	Elizabeth Martin	
Assessor	ANDREW FAHEY	
Assist. Assessor(s)	ANDREW FAHEY	
Completed By	Breearn Foster	
Owner	Tutt Bryant Equipment - NSW	
Customer	CMS PLANT HIRE	
Assessment Purpose	Sale	
State	NSW	

TABLE OF CONTENTS

SECTION 1

IMPORTANT INFORMATION

Contains information outlining the scope and any limitations applicable to this Risk Management Report

SECTION 2

MACHINE DETAILS

Contains standard machine specifications and details of any extras fitted

SECTION 3

SECTION 4

RISK ANALYSIS, RISK EVALUATION & RISK TREATMENT

Contains details of the technique used to calculate risk ratings, time frame and risk treatments. Please refer to this information when reviewing and interpreting the information in section 4 & 5

RISK TREATMENTS REQUIRED

Contains detailed information regarding the risk treatments to be implemented including hazard, risk rating, time frame, relevant standards & legislative references

RISK TREATMENTS IN PLACE

SECTION 5

Contains detailed information regarding the risk treatments in place including hazard, risk rating, relevant standards & legislative references

SECTION 6

IMAGES AND NOTES

Contains images & any relevant information entered by the assessor





Make Yanmar Model VIO17-1

Type Excavator - Small (0 - 9.9 Tonne)

Serial Number Assessed By Date 12017 Breearn Foster 29-Apr-2022

Page 1 of 13

SECTION 1 IMPORTANT INFORMATION

This report generated by Plant Assessor™ © Online Safety Systems on Friday, 29 Apr 2022 12:09 PM

This Risk Management Report has been prepared for -

(insert recipient name/company name)

This document has been prepared to cover the sale or transfer of this item of plant between the Company identified on the front cover and their named recipient. This report must not be used for any subsequent sale or transfer.

This document is provided to meet duty of care obligations as set out in relevant state and territory health and safety regulations for the supply of plant and the sale and transfer of plant.

The safety hazards associated with the operating and maintaining of this item of plant have been identified as far as practical by visual inspection. This item of plant is being sold in an "as-is" condition with known and unknown safety hazards. No physical testing has been conducted (eg. Wire rope tests, stress tests, structural/non-destructive tests, noise tests, vibration tests, brake tests, insulation tests etc.) unless stated otherwise in the notes.

This document is not intended to provide information on, nor warrant the mechanical, electrical or structural condition of this item of plant. Any information on standard features have been supplied through the manufacturer and should be used as a guide only until otherwise verified.

This item of plant should be further assessed, tested and inspected or dismantled as necessary to gauge any further hazards and /or risks relating to SPECIFIC WORKPLACE USE, which are currently unknown, in accordance with relevant standards, regulations and acts.

Under common law and relevant state and territory health and safety acts, regulations and codes of practice, there is a requirement for the plant owner, employer and operator to exercise a duty of care in the safe operation and maintenance of plant. Accordingly before this item of plant is supplied to, or used at any workplace it must be inspected to ensure it is in a fully operational, safe and serviceable condition and that operators and maintenance personnel are appropriately trained in the use & maintenance of this item of plant.

For further information regarding this report contact Online Safety Systems on 1300 72 88 52

SECTION 2 MACHINE DETAILS

40		Manufacturers specified noise level dBA	
၂ ဟု		2. Ambient noise level dBA	
₹		3. Noise level - Operator position (high idle) dBA	
	- NOISE TEST RESULTS	4. Noise level - Operator position (low idle) dBA	
╽⋓╽	- NOISE TEST RESULTS	5. Noise level LHS dBA @ m (high idle)	
		6. Noise level Front dBA @ m (high idle)	
╽╚╽	빅 	7. Noise level RHS dBA @ m (high idle)	
		8. Noise level Rear dBA @ m (high idle)	
MACHIN	BUCKET	Standard bucket capacity, SAE rated (m3)	
		Standard bucket width (mm)	
😝	CAPACITIES	Fuel Tank Capacity (Litres)	
	CAPACITIES	Hydraulic Oil Tank Capacity (Litres)	
		Dig depth to cut 2.44 m level bottom (mm)	
		Digging depth (mm)	
	DIMENSIONS/WEIGHTS	Dump height (mm)	
	DIMENSIONS/WEIGHTS	Ground clearance (mm)	
		Max depth of vertical wall (mm)	
		Operating weight (kg)	





Make Yanmar Model VIO17-1

Type Excavator - Small (0 - 9.9 Tonne)

Serial Number Assessed By Date 12017 Breearn Foster 29-Apr-2022

	Tailswing radius (mm)
	Transport Height (mm)
	Transport Length (mm)
	Width (mm)
	Engine Displacement (Litres)
ENGINE	Engine Hours
	Engine Make & Model
	Engine Number
	Engine Power (kW@rpm)
	Number of Cylinders
EXTRAS	Spare spool for attachments? Yes/No
	Quick Hitch Make
HITCH	Quick Hitch Model
	Quick Hitch Serial No.
	Flow of main pumps (L/Min)
HYDRAULICS	Pump Types
	Relief valve pressure, main pumps (Bar)
DI ANT CLASSIFICATIONS	Class
PLANT CLASSIFICATIONS	Year
	FOPS Compliance No.
CAFETY STRUCTURES	FOPS Serial No.
SAFETY STRUCTURES	ROPS Compliance No.
	ROPS Serial No.
TDACKS	Track length on ground (mm)
TRACKS	Track pad width (mm)
TRANSMISSION	Speed (km/h)
	Arm breakout (kgf)
WORK CARARILITIES	Bucket breakout (kgf)
WORK CAPABILITIES	Gradeability - Degrees/(%)
	Reach @ ground level (mm)
	Air Conditioning
	Bucket - 300mm
	Bucket - 450mm
EXTRAS	Grapple - Semi Fixed
_	Hitch - Quick
	Ripper
	ROPS - Four Post





SECTION 3 RISK ANALYSIS / RISK EVALUATION

RIS	SK ANALYSIS					
			CONS	SEQUENCE————		
LIKELIHOOD ———		1. INSIGNIFICANT Dealt with by in house first aid	2. MINOR Treated by medical professionals, hospital out patients	3. MODERATE Significant non permanent injury overnight hospital stay	4. MAJOR Extensive permanent injury eg. Loss of fingers, extended hospital stay	5. CATASTROPHIC Death, permanent disabling injury eg. Loss of hand, quadriplegia
—— LIKELI	A. Almost certain to occur in most circumstances	MEDIUM 8	HIGH 16	HIGH 18	CRITICAL 23	CRITICAL 25
ļ	B. Likely to occur frequently	MEDIUM 7	MEDIUM 10	HIGH 17	HIGH 20	CRITICAL 24
	C. Possibly and likely to occur at sometime	LOW 3	MEDIUM 9	MEDIUM 12	HIGH 19	HIGH 22
	D. Unlikely to occur but could happen	LOW 2	LOW 5	MEDIUM 11	MEDIUM 14	HIGH 21
	E. May occur but only in rare circumstances	LOW 1	LOW 4	LOW 6	MEDIUM 13	MEDIUM 15

LUATION	CRITICAL	Act immediately to mitigate risk. Implement risk treatment(s) in accordance with the risk treatment table below.
RISK EVA	HIGH	Act immediately to mitigate risk. Implement risk treatment(s) in accordance with the risk treatment table below. If the appropriate risk treatments are not immediately accessible establish interim risk treatment strategies. Permanent risk treatments must be implemented within one week.
	MEDIUM	Take reasonable steps to mitigate and monitor the risk. Implement risk treatment(s) in accordance with the risk treatment table below. Permanent risk treatments must be implemented within one month.
	LOW	Take reasonable steps to mitigate and monitor the risk. Implement risk treatment(s) in accordance with the risk treatment table below. Permanent risk treatments must be implemented within three months.

EATMENT		Selecting the most appropriate risk treatment option involves balancing the costs and efforts of implementation against the benefits derived, with regard to legal, regulatory and other requirements. (Source AS/NZS ISO 31000:2009)	
REAT	Eliminate	Eliminate the risk source.	
RISKT	Substitute	Provide an alternative that is capable of performing the same task which is safer.	
Ч	Engineering	Provide or construct a physical barrier or guard.	
	Administration	Develop policies, procedures, practices and guidelines in consultation with employees to mitigate the risk. Provide training, instruction and supervision about the risk source.	
	Personal protective	Provide personal protective equipment to protect the individual from the risk source.	





Make Yanmar Model VIO17-1

Type Excavator - Small (0 - 9.9 Tonne)

SECTION 4 RISK TREATMENTS REQUIRED

This section of the report pertains to hazards created by use of this item of plant which currently do not have risk treatments in place. The risk treatments recommended in this section have been developed based on relevant Australian Standards, health & safety legislation, the hierarchy of risk treatment in accordance with the guidelines set forth in AS/NZS ISO 31000 – Risk Management and various other sources. The recommended risk treatment measures must be developed, implemented and validated as effective prior to the operation, maintenance or testing of this item of plant. Treatments applied must be dated and initialled adjacent the recommendations. All operators must read and understand the entire contents of this section prior to operating this item of plant.

	HAZARD(S)	Prelim. Risk Rating	Residual Risk Rating	Time Frame	Due Date	Date Rectified	Initial
NOMINATED OPERATOR ONLY	INCORRECT OPERATION	CRITICAL 24	MEDIUM 15	Immediate	29-Apr-22		

Risk Treatment Required: Operator Competency

OPERATION

Only persons who are qualified, trained and experienced and/or hold the relevant certification/license can operate this item of plant. If there is not a competent/licensed person available for operation of this item of plant then only persons who are supervised by a competent/licensed person can operate this item of plant.

Legislation: State Health & Safety Legislation & Regulation

References: Work Health & Safety Act & Regulations-, Occupational Health & Safety Act & Regulations

SECTION 5 RISK TREATMENTS IN PLACE

This section of the report pertains to risk treatments currently in place on this item of plant. This section must be read in conjunction with the safety section of the manufacturers handbook. All operators must read and understand the entire contents of this section prior to operating this item of plant. These treatments or equivalent must remain in place at all times whilst this item of plant is in operation.

Risk Treatments in Place: SWMS Loading/Unloading Ensure that all operators follow approved SWMS/SOP when loading and unloading this machine tilt tray. References: Work Health & Safety Act & Regulations-, Occupational Health & Safety Act & Re CRUSHING Risk Treatments in Place: SWMS Load Restraint Ensure that all operators follow the approved SWMS/SOP when restraining this machine for trans		MEDIUM 15
till tray. References: Work Health & Safety Act & Regulations- , Occupational Health & Safety Act & Re CRUSHING Risk Treatments in Place: SWMS Load Restraint	egulations	ck or trailer, low loader or
CRUSHING Risk Treatments in Place: SWMS Load Restraint		
Risk Treatments in Place: SWMS Load Restraint	HIGH 22	
		MEDIUM 15
Ensure that all operators follow the approved SWMS/SOP when restraining this machine for trans-		
	sport.	
References: Work Health & Safety Act & Regulations- , Occupational Health & Safety Act & Re	egulations	
CRUSHING Risk Treatments in Place: Fully Automatic Quick Hitch - Swing Risk This item of plant was fitted with a fully automatic quick hitch prior to December 31st 2015. This t	CRITICAL 24	MEDIUM 15
Risk Treatments in Place: Fully Automatic Quick Hitch - Swing Risk		
This item of plant was fitted with a fully automatic quick hitch prior to December 31st 2015. This the attachment in the event of a failure of the primary retention system. This hitch must be replaced operators are familiar with the safe use of this hitch.	* *	
References: SafeWork NSW- Position Paper		
CRUSHING	CRITICAL 24	MEDIUM 15
Risk Treatments in Place: Semi-Automatic Quick Hitch Risks		
This item of plant was fitted with a semi-automatic quick hitch prior to April 30th 2014. This type of where the manufacturers safety device (usually a pin) has not been engaged after fitting an attact		

treatment relying on the operator to get off the item of plant and manually engage the safety device. Ensure that all operators are familiar with the safe use of this hitch and NEVER use this item of plant with any attachment if the manufacturers quick hitch safety device is not engaged.





References: SafeWork NSW- Position Paper

Make Yanmar Model VIO17-1

Type Excavator - Small (0 - 9.9 Tonne)

Serial Number Assessed By Date 12017 Breearn Foster 29-Apr-2022

	HAZARD(S)	Prelim. Risk Rating	Residual Risk Rating
	INCORRECT OPERATION	HIGH 22	MEDIUM 15
- 1			

Risk Treatments in Place: Operation Handbook

The manufacturer's operation handbook has been supplied for this item of plant.

This handbook must be available at all times to all potential operators and supervisory staff. All potential operators must read and be familiar with this handbook prior to operating.

A complete risk assessment/Job Safety Analysis must be undertaken covering all operating processes and environments associated with this item of plant. SWMS should be produced for specific tasks associated with use of this item of plant.

References: Work Health & Safety Act & Regulations-, Occupational Health & Safety Act & Regulations

INCORRECT OPERATION HIGH 22 MEDIUM 15 Risk Treatments in Place: Pre-op Checklist Excavator

A pre-operation checklist is available for this Excavator. This checklist must be completed by all operators prior to operating this Excavator.

References: Work Health & Safety Act & Regulations-, Occupational Health & Safety Act & Regulations

INCORRECT OPERATION HIGH 22 MEDIUM 15

Risk Treatments in Place: SOP Excavator

Safe Operation Procedures are available for this Excavator. The information in the Safe Operation Procedures must be followed at all times whilst operating this Excavator.

References: Work Health & Safety Act & Regulations-, Occupational Health & Safety Act & Regulations



All controls including all levers, buttons, pedals, switches etc. are clearly labelled as to their purpose and method of operation. These labels must be maintained in a clean and serviceable condition at all times.

References: AS/NZS4024.1905



Risk Treatments in Place: Passenger Seat Label

This item of plant is fitted with a clear hazard warning label re: Operator only, No passengers. Passengers must not be carried at anytime. This label must be clear and legible at all times whilst this item of plant is in operation.

Legislation: State Health & Safety Legislation & Regulation

References: AS1319-

CRUSHING HIGH 22 MEDIUM 15

Risk Treatments in Place: ROPS seat belt label

This item of plant is fitted with a ROPS and has an advisory label stating that "seatbelts must be worn".

This label must be present, clean and legible at all times.

All operators and passengers must wear seatbelts whilst on this item of plant.

References: AS2294, ISO3471

CRUSHING, INCORRECT OPERATION HIGH 22 HIGH 21

Risk Treatments in Place: Boom Rated Capacity Label

This item of plant has a rated capacity label fitted to each side of the boom. Ensure that these labels are clear and legible at all times whilst this item of plant is in operation. Operators must not exceed this rated capacity at any time during operation.

References: AS1418.8





Yanmar Model VIO17-1

Type Excavator - Small (0 - 9.9 Tonne)

Serial Number Assessed By Date

HIGH 22

MEDIUM 15

12017 Breearn Foster 29-Apr-2022

Page 6 of 13

	HAZARD(S)	Prelim. Risk Rating	Residual Risk Rating
747	ELECTROCUTION	HIGH 22	MEDIUM 15

Risk Treatments in Place: Electrical Approach Distances

This item of plant has a hazard warning label re: overhead electrical hazards and minimum approach distances fitted. These distances must be adhered to strictly. These labels and tables must be present, clear and legible at all times.

Spotters are required when working within 5 metres of the minimum approach distance of any live electrical apparatus.

Any encroach within the minimum approach distances must only occur if the following provisions have been met -

- 1. The machine is designed to work within the minimum approach distances
- 2. Permission has been granted by the electricity company and
- 3. Safe systems of work have been documented and approved.

References: ISO31000



ELECTROCUTION, EXPLOSION

HIGH 22

MEDIUM 15

Risk Treatments in Place: Dial Before You Dig (AUS)

This item of plant is fitted with a clear hazard warning label re: underground services and advice to "Dial 1100 Before You Dig"to the operator work area. This advice must be adhered to strictly. Digging into an electricity cable or gas pipe can cause serious injury or death. Damaging a pipe or cable may also lead to isolating a community from emergency services such as fire, police or ambulance. This label must be present, clear and legible at all times.

References: ISO31000



COLLISION

HIGH 22

MEDIUM 15

Risk Treatments in Place: Phone Use label

This item of plant is fitted with an instruction label advising that mobile phones must not be used whilst operating this machine. Accordingly all operators must not use a mobile phone at any time whilst operating machine. If phone use is necessary then operator must place machine in park configuration in a safe position prior to phone use. Operators MUST adhere to this advice at all times.

This label must be clear and legible at all times whilst this item of plant is in operation.

References: AS1319-, ISO31000



POISONING, EXPLOSION, BURNS

HIGH 22

MEDIUM 15

Risk Treatments in Place: Tank ID Label

The tank(s) on this item of plant have clear, legible label(s) identifying their contents, and if appropriate any necessary controls re: the contents. These must be present, clear and legible at all times. (this includes radiator, hydraulic and petrol/diesel tanks)

References: Work Health & Safety Act & Regulations-, Occupational Health & Safety Act & Regulations



FIRE

HIGH 21

MEDIUM 15

Risk Treatments in Place: Fire Extinguisher

This item of plant is fitted with an approved and maintained fire extinguisher. Fire extinguisher(s) must be present and fully functional at all times. They must be readily accessible to the operator. Regular inspections must also be carried out in accordance with the manufacturer's requirements and AS 1851 – 1995



CRUSHING, INCORRECT OPERATION

HIGH 21

MEDIUM 15

Risk Treatments in Place: Quick Hitch Information

This hydraulic quick hitch has the following information marked upon it -

- 1. A unique identification mark (serial number)
- 2. The manufacturer's name and model clearly and durably marked upon it
- 3. The maximum rated capacity clearly and durably marked upon it
- 4. The mass of the hitch clearly and durably marked upon it
- 5. The lift point capacity (kg) clearly and durably marked upon it

This information must be considered by all operators when assessing the suitability of the hitch for any task. Failure to consider and or comply with this information could lead to serious injury or death.

References: AS4772






Make Yanmar Model VIO17-1

Type Excavator - Small (0 - 9.9 Tonne)

Serial Number Assessed By Date 12017 Breearn Foster 29-Apr-2022

Page 7 of 13

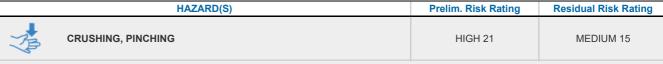

Risk Treatments in Place: Swing Boom Crush Label

This item of plant has clear hazard warning labels re: pinch point/crush zone, keep clear, that are attached to each side of the boom swing/pivot point. These must be present, clear and legible at all times whilst this item of plant is in operation.

References: AS/NZS4024.1201, AS1319-



POOR SIGNAGE, CRUSHING

HIGH 19

MEDIUM 13

Risk Treatments in Place: Boom Lifting Point Table

This item of plant has a lifting point fitted to the boom, accordingly a load/distance table is present at the operator work area. This must be clear and legible at all times. This item of plant must comply with the relevant parts of AS 1418 at all times. All operators must be appropriately trained to use this item of plant and licenced where necessary.

References: AS1418.8



CRUSHING, STRIKING, COLLISION

HIGH 19

MEDIUM 14

Risk Treatments in Place: Tail Swing Label

The rear of this item of plant has a hazard warning label re: general plant movement, tail swing, keep clear. It must be present and fully functional and serviceable at all times

References: ISO20474-



CRUSHING

MEDIUM 15

MEDIUM 15

Risk Treatments in Place: ROPS Label

The warning label stating that the ROPS must not be damaged at any time (including cuts, drill holes and welds) must be present, clean and legible at all times.

References: ISO3471



CRUSHING

MEDIUM 14

MEDIUM 13

Risk Treatments in Place: Front Grader Blade Label

The front blade on this item of plant is fitted with a hazard warning label re: crush zone, keep clear. This label must be present and fully functional and serviceable at all times.

References: AS1319-, ISO20474-



ENTANGLEMENT, SHEARING, BURNS

MEDIUM 14

MEDIUM 13

Risk Treatments in Place: Engine Guard Label

The engine fan and alternator belts, pulleys and gears are guarded. These guards have clear legible hazard warning labels re do not open or remove guards while engine is running. These labels must be present, legible and easily seen at all times whilst this item of plant is in operation.

References: AS/NZS4024.1201, AS1319-



CRUSHING, COLLISION

MEDIUM 12

I OW 6

Risk Treatments in Place: Warning Device (horn)

This item of plant is fitted with a fully functional audible warning device such as a horn. This must be easily accessed by the operator, and easily identifiable by nearby pedestrians.

All operators should ensure the warning devices are functional at the start of each shift, by completing pre-start checklists. Warning devices should operate automatically where appropriate (eg reversing)

References: ISO7731, ISO9533



COLLISION

MEDIUM 9

LOW 5

Risk Treatments in Place: Recovery Point Label

This item of plant is fitted with a hazard warning label adjacent the recovery tow point which states "Recovery tow point – Read manufacturer's towing instructions before towing". Failure to do so could result in DEATH or SERIOUS INJURY.

This label must be clear and legible at all times whilst this item of plant is in operation.

References: ISO31000





Make Yanmar Model VIO17-1

Type Excavator - Small (0 - 9.9 Tonne)

Serial Number Assessed By Date 12017 Breearn Foster 29-Apr-2022

Page 8 of 13

HAZARD(S) Prelim. Risk Rating CRITICAL 24 LOW 1

Risk Treatments in Place: Closed Eye Lifting Point

CRUSHING

The lifting point fitted to this item of plant is the closed eye type. Hooks with or with out latching devices must not be used as a lifting point at any time.

References: AS1418.8



STRIKING, BURNS HIGH 22 MEDIUM 15

Risk Treatments in Place: Hydraulic Hoses

This item of plant has hydraulic hoses. These hoses must be inspected each day or before each use for wear and tear. If there are visible signs of wear immediate action must be taken to control the risk arising from this wear. These inspections must be documented.

Hydraulic fluid at high pressure can penetrate the skin, never use any part of your body to check for leaks. If oil penetrates the skin seek medical advice immediately. Always use a piece of cardboard or similar to check for suspected leaks.

Hydraulic pressure can be stored and is a hazard. Before disconnection or connection of hydraulic hoses complete the following steps -

- 1. Stop engine
- 2. Keep all bystanders clear of the work area
- 3. Refer to operators manual as to methods to release pressure
- 4 Wait 5 minutes

References: AS4024, AS2671



CRUSHING, COLLISION

HIGH 22

MEDIUM 15

Risk Treatments in Place: Loose Items - Operator Work Area

All items that could cause harm to the operator in the event of a collision or rollover are securely restrained.

References: ISO31000



CRUSHING, NON COMPLIANCE

HIGH 22

MEDIUM 15

Risk Treatments in Place: Control Lock out

The primary operator controls are fitted with an isolation device which meets the following requirements -

- a) Must be engaged to allow entry & exit of the machine
- b) Is not easily bypassed.

This device deactivates the primary operator controls. This must be employed during entry, exit and while performing maintenance on this item of plant.

This device must be fully functional at all times whilst this item of plant is in operation.

References: ISO10968



CRUSHING, ENTANGLEMENT, STRIKING, COLLISION

HIGH 22

MEDIUM 15

Risk Treatments in Place: Neutral Start

This item of plant has neutral start control in place. It must be fully functional and serviceable at all times whilst this item of plant is in operation.

References: AS4024.1603



CRUSHING

HIGH 22

MEDIUM 15

Risk Treatments in Place: Quick Hitch Controls

The quick hitch operation control fitted with a device/method to prevent accidental operation. This device must be fully functional at all times whilst this item of plant is in operation.

References: AS4772, AS/NZS4024.1906

CRUSHING

HIGH 22

MEDIUM 15

Risk Treatments in Place: Seat Belt

This item of plant is fitted with an operator seat belt. This seat belt must be free from damage, and permanently and sturdily attached at all times whilst this item of plant is in operation. Operators must use this seat belt at all times during operation.

References: ISO6683





Make Yanmar Model VIO17-1

Type Excavator - Small (0 - 9.9 Tonne)

Serial Number Assessed By Date 12017 Breearn Foster 29-Apr-2022

Page 9 of 13



Risk Treatments in Place: Quick Hitch Operation Alarm

This item of plant is fitted with a quick hitch with a fully functional audible alarm fitted to the operator work area to alert the operator that the host machine is in the mode that allows for the controls to be operated to engage or disengage attachments.

This alarm must be fully functional at all times whilst this item of plant is in operation.

References: AS4772, ISO7731



CRUSHING

HIGH 22

MEDIUM 15

Risk Treatments in Place: Movement Awareness Alarm

An automatic movement awareness alarm is fitted to this item of plant. This alarm is automatically activated when travel in any direction occurs. It must be fully functional and serviceable at all times whilst this item of plant is in operation.

References: ISO7731, ISO9533



CRUSHING, ENTANGLEMENT, SHEARING, BURNS, PINCHING

HIGH 22

MEDIUM 15

Risk Treatments in Place: Safe Operator Location

This machine is designed so that the operator is isolated from all danger zones whilst at the operator position. This condition must exist at all times whilst this item of plant is in operation.

References: AS/NZS4024.1201



POOR VISIBILITY, COLLISION

HIGH 22

MEDIUM 15

Risk Treatments in Place: Machine Lights

This item of plant is fitted with self contained lighting. All of these lights must be fully functional and serviceable whilst this item of plant is in operation in areas of reduced light. If any of these lights stop working the operation must cease immediately and the faulty light be repaired before operation can continue in the areas of reduced light.

References: ISO20474-



ENTANGLEMENT

HIGH 22

MEDIUM 15

Risk Treatments in Place: Engine Guards

The engine fan and alternator belts, pulleys and gears are guarded. These guards must be present and fully functional and serviceable at all times whilst this item of plant is in operation.

References: AS/NZS4024.1601



INSTABILITY, CRUSHING, TIP OVER

HIGH 22

MEDIUM 15

Risk Treatments in Place: Levelness Device

This item of plant is fitted with a level indicator. This device indicates the "levelness" of the machine chassis.

During operation operators must ensure the machine is within the manufacturers guidelines for levelness.

The rated capacity chart fitted for lifting operations has a maximum level angle which must never be exceeded during lifting operations.

This level indicator must be present and fully functional at all times whilst this item of plant is in operation.

References: AS1418.8



COLLISION

HIGH 22

MEDIUM 15

Risk Treatments in Place: Beacon

This item of plant is fitted with a safety beacon. This beacon must meet the following criteria at all times whilst this item of plant fitted is in operation -

- Is visible up to 200m in all directions (allowing for intermittent obstruction from the plant structure whilst the plant is in operation)
- Is fitted in the most appropriate location on machine to maximise visibility without risking continual damage

NOTE: more than one beacon may be fitted to meet these criteria.

References: ISO20474-





Make Yanmar Model VIO17-1

Type Excavator - Small (0 - 9.9 Tonne)

Serial Number Assessed By Date 12017 Breearn Foster 29-Apr-2022

Page 10 of 13





ENTRAPMENT

HIGH 21

MEDIUM 15

Risk Treatments in Place: Two Operator Exits

The operator cabin/work area on this item of plant has a minimum of two (2) possible exits. These must be functional and accessible at all times whenever the item of plant is manned, whether during operation or maintenance activities.

References: AS5327

ROPS FITTED

CRUSHING

HIGH 21

MEDIUM 15

Risk Treatments in Place: ROPS

A Roll Over Protective Structure (ROPS) to ISO 3471, ISO 12117.1 or 2, AS 2294 or AS 4987 is fitted to this item of plant. A permanent label stating this standard must be attached to the structure at all times. This structure provides a safety envelope during a rollover. A warning label re: wearing of seat belts at all times whilst this item of plant is in operation and accordingly seat belts must be worn at all times during operation.

References: AS4987, AS2294, ISO3471



INCORRECT OPERATION

HIGH 20

MEDIUM 14

Risk Treatments in Place: Intuitive Controls

The controls fitted to this item of plant are orientated so that the movement of the control is consistent with the action of the machine e.g. moving a control lever to the left results in the machine turning to the left. This design feature must be maintained at all times whilst this item of plant is in operation.

References: AS/NZS4024.1906



STRAINS

HIGH 19

LOW 5

Risk Treatments in Place: Controls Ergonomics

All controls including all levers, buttons, pedals, switches etc, are placed near the operator work position and are easy to reach and operate during the execution of the operator's normal duties. This applies for all persons within the 95th percentile of the normal population distribution.

References: AS/NZS4024.1901



STRIKING, BURNS

HIGH 19

LOW 5

Risk Treatments in Place: Hydraulic Hose Failure Shield

This item of plant is fitted with a sturdy, permanent shield(s) between the hydraulic hoses and any body parts of the operator to provide protection during a hose or component failure. This shield(s) must be present and fully functional at all times whilst this item of plant is in operation.

References: AS4024, ISO4413, AS2671



INCORRECT OPERATION, SLIPPING

HIGH 17

I OW 6

Risk Treatments in Place: Control Levers/Pedals/Buttons

All controls including all levers, buttons, pedals, switches etc. must be kept non-slip and free from damage at all times.

References: AS/NZS4024.1901

If you can't see my mirrors I CAN'T SEE

POOR VISIBILITY, COLLISION

MEDIUM 12

MEDIUM 11

Risk Treatments in Place: Operator Mirror

This item of plant is fitted with at least one rear vision mirror. This mirror must be fully functional and clean at all times whislt this item of plant is in operation.

References: ISO5006





Make Yanmar Model VIO17-1

Type Excavator - Small (0 - 9.9 Tonne)

Serial Number Assessed By Date 12017 Breearn Foster 29-Apr-2022

Page 11 of 13

HAZARD(S)

Prelim. Risk Rating

Residual Risk Rating

BATTERY

ELECTRIC SHOCK, BURNS

MEDIUM 12

LOW 6

Risk Treatments in Place: Battery Cover

All batteries fitted to this item of plant are constrained to prevent displacement & fitted with a permanent sturdy cover which allows for ventilation. The constraint and cover must be present and fully functional and serviceable at all times whilst this item of plant is in operation.

References: AS/NZS4024.1201



INCORRECT OPERATION, SLIPPING

MEDIUM 9

LOW 4

Risk Treatments in Place: Work Area Floors

All work area floors are non-slip and free from damage & debris.

Floor area must remain non-slip and free from damage & debris, including rubbish, tools and other items, at all times whilst this item of plant is in use.

References: AS/NZS4024.1201, ISO20474-



STRAINS

MEDIUM 9

LOW 1

Risk Treatments in Place: Operator Seat

The operator seat fitted to this item of plant must remain free from damage and tears, and be permanently and securely fitted at all times.

References: AS/NZS4024.1401, ISO20474-



BURNS

MEDIUM 9

LOW 5

Risk Treatments in Place: Exhaust

The engine exhaust on this item of plant is fitted with a guard to prevent injury to any person and control the risk of initiating a fire. It must be present and fully functional and serviceable at all times whilst this item of plant is in operation.

References: AS/NZS4024.1201



CURRENT OR PREVIOUS STRUCTURAL DAMAGE

CRITICAL 25

MEDIUM 15

Risk Treatments in Place: Structural Integrity

Regular checks for structural damage must be undertaken. Look for cracks in frames/chassis (current or repaired), bends or damage to structural components, etc.

References: ISO31000



INCORRECT OPERATION

HIGH 22

MEDIUM 15

Risk Treatments in Place: Maintenance Manual

The manufacturer's maintenance manual(s) has been supplied for this item of plant

These manual(s) must be available at all times to all users and maintenance staff of this item of plant. All users and maintenance staff must read and be familiar with these handbook(s) prior to maintaining or repairing this item of plant.

A complete risk assessment/JSEA must be undertaken covering all inspection, maintenance, servicing and transportation requirements of this piece of plant prior to use.

A full assessment of the competence of people using the book(s) must also be undertaken

References: Work Health & Safety Act & Regulations-, Occupational Health & Safety Act & Regulations



STRIKING, BURNS

HIGH 22

MEDIUM 15

Risk Treatments in Place: Hydraulic Damage

The hydraulic hoses to this item of plant are free from damage and protected against damage arising from contact with the plant structure. Ensure that hoses are free from damage and that protection is in place at all times whilst this item of plant is in operation. Inspection of the hydraulic hoses and protection system should be conducted regularly and documented as part of your plant safety programme.

References: AS4024, ISO4413, AS2671





Make Yanmar Model VIO17-1

Type Excavator - Small (0 - 9.9 Tonne)

Serial Number Assessed By Date 12017 Breearn Foster 29-Apr-2022



CRUSHING

HIGH 22

Prelim. Risk Rating

Residual Risk Rating
MEDIUM 15

Risk Treatments in Place: ROPS Damage

The Roll Over Protective Structure (ROPS) fitted to this item of plant must remain free from damage at all times whilst this item of plant is in operation.

References: AS2294, ISO3471



OPERATIONAL MALFUNCTION

HAZARD(S)

HIGH 22

LOW 2

Risk Treatments in Place: Major Fluid Leaks

This item of plant must remain free from leaks at all times whilst in operation (this includes engine, transmission, cooling system, air, fuel, drive line, wheel hubs, steering and hydraulics). Development of a major leak will require this item of plant to be stood-down until repaired. Minor leaks detected must be repaired within 1-14 days.

References: ISO31000



OPERATIONAL MALFUNCTION

HIGH 21

MEDIUM 15

Risk Treatments in Place: Service Records

Service and maintenance records are available for this item of plant.

These records must continue to be managed and available at all times as part of your service and maintenance programme. (This programme includes the undertaking of regular inspections of the item of plant with specific reference to all OEM prescribed, scheduled and non scheduled service and maintenance requirements).

References: Work Health & Safety Act & Regulations-, Occupational Health & Safety Act & Regulations



INSTABILITY, COLLISION

MEDIUM 9

LOW 4

Risk Treatments in Place: Tracks

The tracks and track components must be inspected as part of a "pre start" checklist. These inspections must be documented as part of your plant safety programme.

References: ISO20474-

SECTION 6 IMAGES AND NOTES

IMAGES

- No Images Available -

NOTES

- No Notes Available -





Make Yanmar Model VIO17-1

Type Excavator - Small (0 - 9.9 Tonne)

Serial Number Assessed By Date 12017 Breearn Foster 29-Apr-2022

Page 13 of 13



RISK MANAGEMENT REPORT

TYPE	Excavator - Small (0 - 9.9 Tonne)	Report Number	BTE 20220322-1618
MAKE	Yanmar	Date	29-Apr-2022
MODEL	VIO17-1	Created By	Elizabeth Martin
SERIAL NUMBER	12017	Assessor	ANDREW FAHEY
ENGINE NUMBER	T2538	Assist. Assessor(s)	ANDREW FAHEY
		Owner	Tutt Bryant Equipment - NSW
		Customer	CMS PLANT HIRE
		Assessment Purpose	Sale
		State	NSW

PURCHASER ACKNOWLEDGEMENT

I the undersigned acknowledge that I have read and understand the risk management report described above. I also acknowledge that I have recieved a copy of this risk management report. I also acknowledge that I am authorised to sign on behalf of the purchaser.

Name
Company Name
Position
Signature
Date
The manufacturer's operational & maintenance handbooks have been supplied, (circle one) YES NO (initial)
Please transfer this assessment to my Plant Assessor membership as a (circle one) HIRE / PLANT IN USE assessment.



Serial Number

Assessed By

Date

BTE 20220322-1618